

ATTENTION!! Trouble on Rotary Type Starting Air Distributor

—Prepare KIT SPARES in Precaution—

Engine Type:L50•60•70•80MC(E)

There is a number of reports that ships became out of operation by the trouble of rotary type starting air distributor.

The trouble occurs in following sequence:

1. At first, gas leakage occurs at starting valve.
2. The leaked gas flows into starting air distributor through non-return valve.
3. The distributor disk (item 002) corrodes by water and oil in the leaked gas, compromizing with compressed starting air.
4. Also the leaked gas presses distributor disk against reversing disk (item 001), which causes constant sticking each other and thereby comes to abrasive wear.

For precaution, we would recommend you to keep a set of spares in "KIT" for emergency as well as for regular replacement during dry-docking.

The KIT SPARE is available from us in pre-assembled kit set so as to eliminate mounting difficulty on board.

For order placing, please specify simply "KIT NO. L007 (DIST)"

No.	Description PLATE No. 90703	名 称 (L007 KIT)	50, 60, 70MC		80MC
			27	27A	34X
001	Reversing disc	逆転盤	1	1	1
* 002	Distributor disc	管制盤	1	1	1
* 003	Closing disc	閉塞盤	1	1	1
* 004	Stop disc	ストッパー	1	1	1
* 005	Flange	フランジ		1	
* 006	Ring	リング		1	1
* 007	Spring pin	スプリングピン		1	
008	O-ring	O-リング	1	1	1
* 009	Bolt	ボルト		8	
* 010	Nut	ナット		8	
* 011	Split pin	割りピン		8	
012	U-nut	U-ナット	1		
013	Washer	座金	1	1	1
014	Oil seal	オイルシール	1	1	1

Please refer to the next page.

Hitachi Zosen Diesel Service Corporation

Tokyo Office

Palace Side Bldg.
1-1-1, Hitotsubashi, Chiyoda-ku, Tokyo, 100 Japan
TEL : +81-3-3215-1722
FAX : +81-3-3217-8588
TLX : 222-2156

Osaka Office

2-3-81, Kizugawa, Naniwa-ku, Osaka, 556 Japan
TEL : +81-6-562-3411
FAX : +81-6-562-2900
TLX : 524-2101

Singapore Office

15, Benoi Road, Singapore,
6298888
TEL : +65-863-1490
FAX : +65-861-7579
TLX : HZSIN RS 21906/21213

PLATE No.

90703 - 27

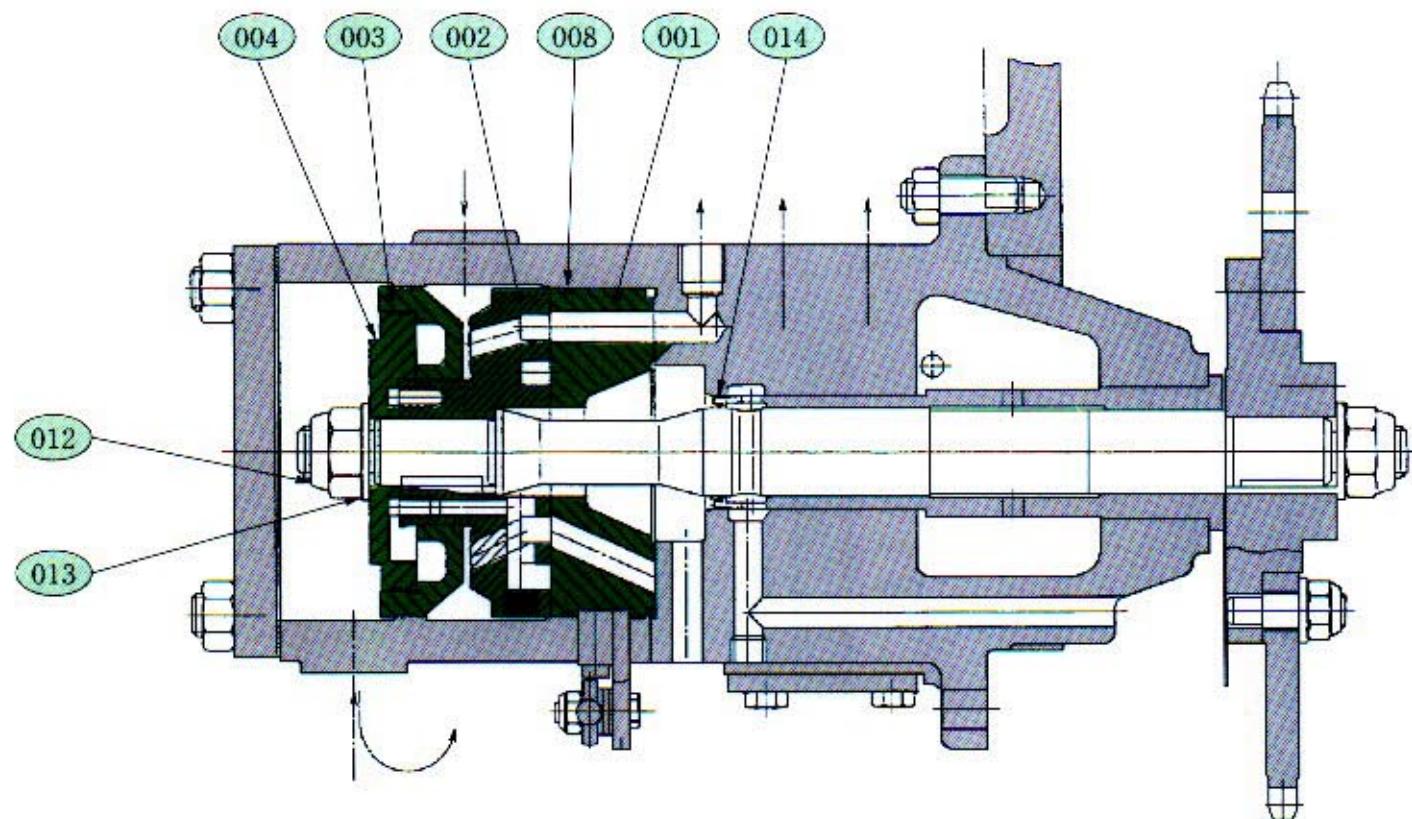


PLATE No.

90703 - 27A

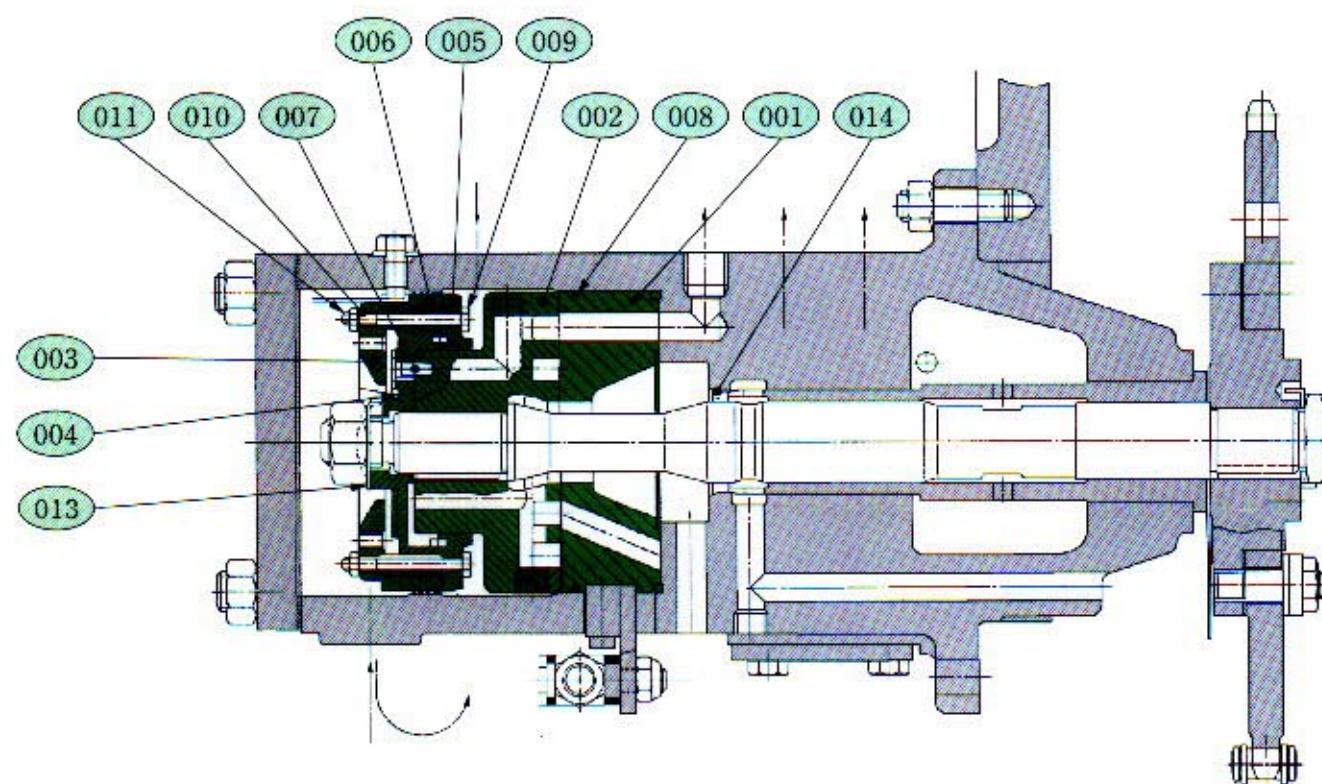


PLATE No.

90703 - 34X

